

Heating system details...

George R. Carey Jr.



The following stories are examples of what can happen to heating systems when some or all of the "details" are ignored.

A large apartment complex in downtown Boston was experiencing some very severe overheating with their steam system. The management company had recently purchased a weather-responsive control from our company. This control was suppose to

measure the indoor temperature, the outdoor temperature and then make a decision on how long the burner/boiler should run to satisfy the building's heating needs.

I met with the service technicians who were trying to figure out the problem. We started by going through the operation of the control. Within a few minutes, we found one of the problems. One of the components of these weather-responsive controls is a sensor that is located near the end of a steam supply main. It is wired back to the control and its purpose is to sense when there is temperature in the system. This tells the control that steam has been distributed throughout the building. Now the control will let the boiler run for so many minutes on and then keep it off for so many minutes based upon the heating cycle. However, none of this can happen until the "steam-established" sensor measures temperature in the system.

In this system, someone installed the sensor on a return line that had long been disconnected from the system. That's why the building was overheating. The sensor never "sensed" any temperature, so the control kept telling the

visual OIL-PRO


for Windows

Commitment, Customer Service, and Integrity

Now with Virtual Private Network capabilities, Visual OIL-PRO can bring the advantages of having everything under one roof to a multi-office company. Of course, Visual OIL-PRO has all of the playing pieces: A/R, Degree Days, inventory control, credit controls, security, third party interfaces for wireless communication, financial systems, palm pilots, MID:COM, Liquid Controls, Credit Cards, EFT, and more.

Visual OIL-PRO is currently running companies with over 50,000 customers in a single database. Multiple database companies are, and always have been available.

Even the smallest companies can take advantage of the power of Visual OIL-PRO because Visual OIL-PRO is sold by the number of workstations. A single workstation with all the power of Visual OIL-PRO (not a stripped down version) starts at \$2,300.00.

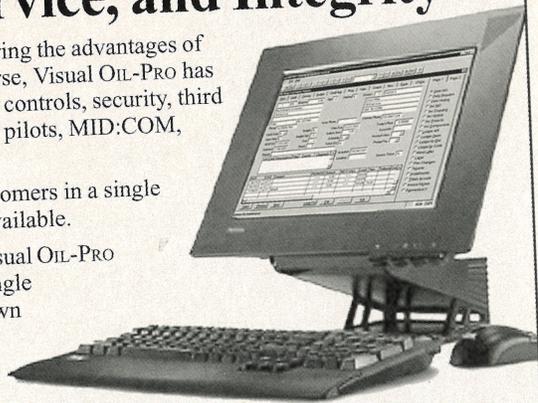

Micro-Analysts Associates

24 Brant Avenue, Clark, NJ 07066 732-499-7400 www.micro-analysts.com

Write in Readers Service Card No. 130

Heating system details...

boiler to run and run! The boiler was cycling off its pressure control. The solution was to relocate the sensor to one of the steam mains.

As we walked through the building, I noticed the basement apartments, which were on the same grade as the boiler room, had two-pipe radiators with steam traps. The steam system had no condensate return pumps, only gravity returns. Therefore, these radiators should be filled with water all the time because they are below the water line of the boiler. However, I was told they were working fine. I asked the maintenance man if he knew anything about these radiators and he started to smile and said, "follow me". He took us outside to the courtyard and pointed to all the holes in the building where pipes were draining water. Every basement radiator was piped to the outside where its condensate was dumped! No wonder they were "working". Of course, the make-up water was eating the cast-iron sections for lunch and the fuel usage had to be excessive, but at least the basement apartments were warm!

This is a good one and it's true! A local service manager

contacted me to look at a heating system his installation department had installed two years ago.

The system consisted of five zones of baseboard and one indirect water heater. They installed a good air separator with a diaphragm expansion tank and pressure-reducing valve on the supply. They also installed all the circulators on the supply, "pumping away" from the expansion tank. That is why he had me at the job. It turns out the homeowner was threatening to sue the oil company because the circulators were on the supply-side of the system. Huh???

Recently, the homeowner had a family party and a relative, who happen to be a plumber, looked at the heating system and proudly exclaimed, "This system will never work! These circulators **have to be** installed on the return so they can pull the water back from the system."

He explained that these circulators would never be able to lift the water out of the boiler, which is why the system will never heat! Mind you, the system has gone through one heating season and is now entering its second one. Of course, the house has heated wonderfully. Nevertheless, the

Raise a glass

to the industry and heat up your potential for better business at the

Canadian Oil Heat Association's premiere industry conference, Oilheat 2003!

Join us on June 5, 6 & 7, 2003

at White Oaks Resort in the historic Niagara Peninsula.

Oilheat 2003 will play host to a number of speakers who will tackle the topics that matter to you and entertainment to satisfy every taste! Take advantage of the valuable networking opportunities this year's conference has to offer. Join us as we toast the new oilheat!

For more information about Oilheat 2003, please visit us on line at www.coha.ca



"plumbing relative" convinced the homeowner that his heating system will not work and that is why he is suing the oil company.

So here is a little warning to all you oil companies that believe in installing your circulators on the supply. We all know it is the better way of installing circulators. The system operates quieter, with no gurgling or sloshing noises. But, make sure you tell your customers to keep their relatives away from their new heating systems!

I recently saw another system where the main vents and the radiator vents on the first floor were spitting water. Naturally, in addition to the spitting, there was a fair amount of water hammer. I met one of the service technicians from the oil company at the job and he walked me around the building. The system was a one-pipe steam system with a gravity wet-return. One of the things I noticed was, at the end of each main and at the base of each riser, a float and thermostatic trap was installed. The outlet of each trap then drained into the wet-return that ran on the floor around the basement and into the Hartford Loop.

We walked over to the boiler and checked out the settings on the pressuretrol. It was set for five psi. and the differential was set for two psi. This means the system's pressure operated between three and five psi. I was starting to see the cause of the problem. We then measured the distance between the outlets of the traps and the water line of the boiler. There was only three feet of vertical distance between them.

When you have steam traps in a system, remember that one of the functions of the trap is to prevent the steam from getting past the trap and into the return lines. The traps on this job were working fine. Unfortunately, in this situation, it was the cause of the problem. Remember that this was a one-pipe system with gravity returns. There was no condensate or boiler feed pumps so there was no need for the traps. Why someone bothered to install them is another story. Without any steam pressure in the return, the only help the returning condensate had to overcome the pressure in the boiler was its static pressure. For every pound of pressure in the boiler, the water would have to stack up 30".

In this system, the boiler was running between three and five pounds. Therefore, the water would have to stack up 90" to 150" (7' to 12') to enter the boiler. This explains why the vents were spitting water. As the boiler was firing and building steam pressure, the condensate returning from the system was "stacking" in the returns trying to develop enough pressure to overcome the pressure in the boiler. Eventually, the condensate backed up high enough to reach the first floor radiator vents.

This situation also explained why the boiler was flooding. Initially, they thought it was a defective water feeder so they replaced it. However, when the problem persisted, they asked for help.

We concluded that while the condensate was backing up in the system, trying to overcome the boiler pressure, it was

not able to return to the boiler. This obviously affected the water level, causing the automatic feeder to add make-up water into the boiler. Once the system satisfied and shut the boiler off, the leftover steam condensed in the boiler, allowing all the water out in the system to drain back. This raised the water level to the point of flooding the boiler. The quick solution to this system's problem was to replace the pressuretrol with a vaporstat. The vaporstat allowed us to set the maximum pressure at 14 ounces. By keeping the pressure low in the boiler, the condensate would not have to stack any higher than 28"-30" which was still below the F&T traps. We also added extra main vents near the end of each main to improve the venting capacity. This helped prevent the burner from short cycling due to the lower pressure settings.

These are just a few examples of some of the more interesting jobs I have seen this year. If you have any questions, please e-mail me at gcarey@fiainc.com or call 1-800-423-7187.

Barometric Draft Control



Life cycle tested to
80 years.



When you install an Effikal® barometric draft control, it almost certainly will outlast you. Its electro-galvanized or stainless steel construction—featuring integral pivot points rather than corrosion-susceptible pins—provides tough, trouble-free performance and superior corrosion protection, even when installed in harsh environments. Adjustment weight is easily accessible at the exterior of the unit. And installing it is as simple as securing two anchor tabs or cinching an adjustable strap.

For a look at our complete line of dampers, visit www.effikal.com. To discuss your needs, give us a call.

248.370.9554
sales@effikal.com www.effikal.com

EFFIKAL
INTERNATIONAL INC.

Effikal is a registered trademark of Effikal International.

Write in Readers Service Card No. 132